

OC 7040A Programmable Controller LAN, WebServer

- \checkmark 6 digit Display ± 999999
- \checkmark ± 100 000 true increments
- ✓ 0/4-20mA, 200mV to 300VDC
- ✓ 20mV for Strain Gauges
- ✓ Potentiometric Input
- ✓ Pt-100, Pt-200, Thermistor
- ✓ Thermocouples J, K, E, S, B, T, C
- ✓ True R.M.S. measurements
- ✓ Four Set point Relays
- ✓ Two Analogue Outputs
- ✓ Two Serial Data Ports

OC7040A is six digit а programmable controller with 100000 true increments. Thev can be scaled within the full display range 0-999999. The controller is mainly designed for process signals such as 0/4-20mA, 20mV to 300V DC or true RMS, strain gauges, Pt-100, Pt-200, Thermistor, Resistors and **DIN-Thermocouples.**

By using the keyboard, the input signal can be assigned to any two desired display values, such as 4-20mA = 0-18500.

The menu contains four Set Points, two Analog Outputs, two serial Data Ports, the Filter, the Tare, the Sampling Rate, the Display Resolution, the Display Counting, and the Password.

Four Set Points can be set within the entire display range. They activate four open collector transistors or four mechanical relays. Each set point has programmable hysterese and delay.

Serial Data Ports RS232 and RS485 with free programmable parameters can be used for communication with controllers, PCs, remote displays and other data acquisition systems.

Digital Filter can be used in environments noisy or for unstable signals and calculates the average value of the preselected number of measurements prior they arrive at the display. The filter constant can be set from OFF to 99.

Tare can be activated with the keyboard and force the display to zero. The Tare remains memorized also when the instrument is switched-off from the supply. The Tare can be canceled at any time and the display returns to follow the original input signal.

Analogue Outputs 0/4-20mA and 0-10V can be used as direct or inverted and assigned to any two display values with the keyboard. **Peak and Valley** memory measures and stores the maximum and the minimum value the display achieves during the entire measuring period.

With the keyboard the display can be selected to show the momentary measured signal, the minimum or the maximum value.

If e.g. the maximum value is selected, the display will continuously show the peak signal and will be overwritten with any higher value.

Password can be used to protect the instrument from unauthorized operation.

Excitation for external sensors is isolated and adjustable from 5 to 24VDC - 40mA. Optional 1mA constant current output is available for special applications.

The instrument is enclosed in a 48x96mm DIN cabinet and powered from the mains or DC supply. The front is IP65.

ORBIT CONTROLS AG Zürcherstrasse 137 CH – 8952 Schlieren

© orbitcontrols 2904

Tel: +41 44 730 2753 info@orbitcontrols.ch www.orbitcontrols.ch

SPECIFIC



INPUTS and RANGES Voltage

 \pm 100mV to 300V DC or true RMS.

Option 20mVDC for strain gauge **Current**

0/4-20mA, \pm 20mA to 5A DC or true RMS.

Pt-100, Pt-200

2 or 4 terminals -200...+650°C to PT385.

ОНМ

 10Ω -100k Ω , 2 or 4 terminals **DIN Thermocouples**

DIN E, J, K, S, B, C, T.

Cold Junction Ambient temperature 0 - 60° C. Thermistor 9796 Ω @ 0°C, 27936 Ω @ 0°C

ACCURACY

DC ranges \pm (0.01%+1digit) from value. True RMS DC - 5 kHz: \pm (0.1% from value

+ 2 digits). Temperature Pt-100 and T/C

- *Pt-100/200:* ±(1°C+1 digit).
- *T/C, Thermis:* ±(2°C+1 digit).
- *Tempco:* ±25 ppm/ °C.

A-D CONVERTER

Resolution 100 000 true increments. Sampling Rate 2.5 or 7 samples/sec. Linearity ± (1 LSB + 1 digit).

ANALOGUE OUTPUT

Voltage output: 0-10V. Current output: 0/4-20mA. Resolution: 12 Bit. Option: 16 Bit Both outputs are generated simultaneously and available at the output at the same time.

SERIAL DATA BUS

RS232 and RS485 with 8Bits, No Parity, 1 Start, 1 Stop, 600-19200 bd. RS485-Address: 01-31 <u>RS232</u>: Continuous Transmission <u>RS485</u>: Request Transmission. Isolation 250V RMS.

FILTER

Average filter with programmable constants 1 to 99 is suitable for noisy and disturbed signals.

SET POINTS

Four 6 digit Set Points with hysterese control four NPN open collector transistors 60V-100mA or four mechanical relay 5A-230VAC. Programmable delay from 100ms to 3600ms.

DISPLAY COUNTING

The LSD can be programmed for counting 0,1,2,3...9, or 0,2,4,6..., or 0-5-0-5 or dummy zero.

DISPLAY

0 ... \pm 999999, 7 segments red 14, 7 mm LED with decimal points

SUPPLY

115V/230V \pm 15%, 48 - 60 Hz. Option: 24VDC or 9-36VDC.


EXCITATION

Sensor Supply 5-24VDC. 5V/40mA, 24V/100mA. Option: 1mA constant current.

CABINET IP65

DIN 48x96x100 mm (HxWxD). Panel cut-out 45 x 90 mm. Pluggable screw terminals.

TERMINALS

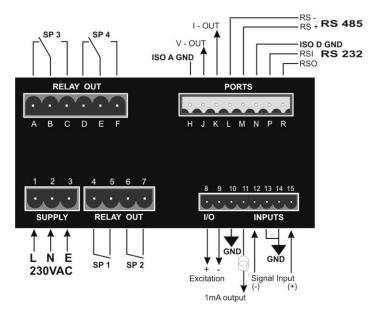

Standard instruments contain two Set Point Relays SP1, SP2, Supply 230VAC (115VAC) and adjustable excitation 5-24V.

Available Options:

- * SP3, SP4 additional 2 Relays.
- * Analogue Outputs 0/4-20mÅ and 0...±10V.
- * Serial Data Ports RS232 and RS485.
- * Supply 9-36VDC.
- * Customized Software.